## BEA 050/250/350/450/840/850

# Introduction of Andros-measuring chamber

From FD 2007-07 onwards, the BEA is equipped with the Andros measuring chamber. All the functions of the BEA remain as they were; the Andros measuring chamber is structurally smaller as compared to its predecessor and is easier to maintain.

#### An overview of the purchase order numbers for add-on kits and replacement parts:

Description	Purchase order number for	Purchase order number for
	Siemens-measuring chamber	Andros-measuring chamber
Measuring chamber	1 685 115 147	1 685 115 154
	1 682 666 003 (Replacement)	1 682 666 310 (Replacement)
AMM	1 687 022 768	1 687 001 881
		1 682 666 309 (Replacement)
BEA 050	0 684 105 050	0 684 105 051
NRS gasoline for BEA 150 up to BEA 350	1 687 001 506	1 687 001 866
NRS gasoline for BEA 110 up to BEA 810	1 687 001 576	1 687 001 865


#### Replacement of a Siemens-measuring chamber within the warranty period

If a Siemens measuring chamber breaks down within the warranty period, then a Siemens-measuring chamber 1 682 666 003 has to be ordered and installed.

### Repair of a Siemens-measuring chamber

In case of repairs, not the Siemens-measuring chamber but the installed exhaust-gas measuring module 1 687 022 768 (AMM including the Siemens-measuring chambers) have to be replaced with the new AMM 1 682 666 309. The AMM 1 682 666 309 contents the Andros measuring chamber 1 685 115 154, which is actual not supported in all countries. Please check your software, if it supports the Andros measuring chamber, see "Gesamtübersicht aller Software-Versionen" in EDIS.

The replacement kit NO 1 687 001 504 can be upgraded without any modifications in case of Andros-measuring chamber.

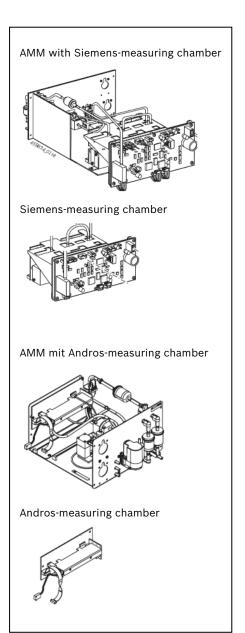

Distribution : EDIS 200708\_067 (updated 2009-09-14) Page 1 of 1